

CONNECTOR TERM TRANSLATION

■Parts List

部品名	DESCRIPTION
接続スリーブ	SHELL
絶縁体	INSULATOR
ガスケット	GASKET
ウェーブワッシャー	WAVE WASHER
ワッシャー	WASHER
本体、シェル	BODY
中心コンタクト	CENTER PIN
圧着スリーブ	FERRULE
締付ナット	NUT
保持リング	HOLDING RING
ブッシング	BUSHING
平ワッシャー	FLAT WASHER
半円平ワッシャー	HALF FLAT WASHER
スペーサー	SPACER
接続ナット	COUPLING NUT
外部コンタクト	OUTER CONTACT
Oリング	O-RING
六角ナット	HEX NUT
クランプ	CLAMP
ホルダー	BARREL
フタ	COVER
割りクランプ	SPLIT CLAMP
留めネジ	SCREW
バネリング	SPRING
ヒートシンク	HEAT SINK
抵抗器、抵抗素子	RESISTOR
スプリングワッシャー	SPRING WASHER
六角穴留めネジ	SOCKET HEAD CAP SCREW
ブラケット	BRACKET
ブッシュ	BUSH
同軸型避雷管	COAXIAL LIGHTNING ARRESTER
丸型端子	ROUND TERMINAL
減衰素子	ATTENUATION TERMINAL

■Parts List

部品名	DESCRIPTION
表示シール	STICKER
熱収縮チューブ	HEAT SHRINK TUBE
丸ナット	RING NUT

■Material List

材質	MATERIAL
亜鉛ダイカスト	ZnDC
ジラコン	POM
シリコンゴム	SILICONE
テフロン	PTFE
鉄、炭素工具鋼	CARBON STEEL
黄銅	BRASS
ベリリウム銅	BERYLLIUM COPPER
リン青銅	PHOSPHOR BRONZE
無酸素銅	OXYGEN-FREE COPPER
アルミニウム	ALUMINUM
ステンレス	STAINLESS STEEL

■List of Notations on Drawings

取付穴参考寸法	MOUNTING HOLE
最大パネル厚さ、使用可能パネル厚	PANEL THICKNESS
識別No.	SERIAL No.
刻印	STAMP
Dカット幅	D FLAT
Hカット幅	H FLAT
アヤメローレット	DIAMOND KNURL
タテメローレット	STRAIGHT KNURL
識別溝、目印、溝	GROOVE

■Surface List

処理	FINISH
三元めっき	TERNARY PLATING
黒色アルマイト	ANODAIZING(BLACK)
パッシベイト	PASSIVATE

PRODUCT SPECIFICATIONS

Part No. NJ-17/U

DWG No. J-0522977

Nominal 1 Standard

2 Voltage rating

3 Impedance

JIS C 5411

AC 500V

50 Ω

No. 0521338

To-Conne Co., Ltd. (TYC)

Checked	Inspected	Prepared
山 12.01.05 本	檜 12.01.05 澤	山 12.01.05 口

	Test Items	Procedures/Test method	Requirements
1	DESIGN	Design & construction	Specified on relevant product drawing (DWG No. J-0522977) No defects or abnormalities
2		Materials	
3		Finishes	
4	ELECTRICAL	Insulation Resistance	DC 500V 1000MΩ (Min.)
5		Withstanding voltage	AC 1000V (1 minute.) No defects or abnormalities
6		Contact resistance	The method of which, the voltage drop of the contact duration should not exceed 1-kHz AC or 1mV DC 3mΩ (Max.)
7	MECHANICAL	Compatibility	Connecting with a standard-compliant connector No defects or abnormalities
8		Center contact retaining force	When using the standard pin gauge 1.0N (Min.) No defects or abnormalities
9		Durability	5000 matings
10		Corrosion resistance	Neutral 5% salt water performed for 48 hours Insulation resistance satisfies item 5, contact resistance is 50mΩ or less under condition 6, and there are no abnormalities such as cracks, cracks, or deformation.

GKQM-19-1

	Remarks	Date
1		
2		
3		

NJ-17/U Cable Assembly Instructions

Cable group RG-17/U, RG-17A/U

All parts of the connector as shown

DRAWING NO.

J-0522977



DRAWN

INSPECTED

APPROVED


CHECKED

渡邊
'23,12,15
直弘

檜
'23,12,15
澤

山
'23,12,15
本

三
'23,12,15
村

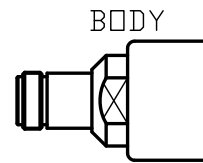

BODY



BUSHING
(INSIDE DIAMETER $\phi 17.8$)



CENTER PIN



CLAMP




GASKET




WASHER
(INSIDE DIAMETER $\phi 22.8$)




NUT

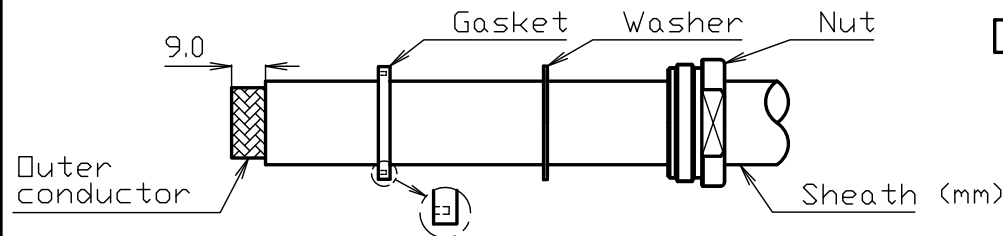


- Slide the nut, washer, gasket over cable and strip jacket to dimension shown in diagram. Note the direction of the groove for the gasket.

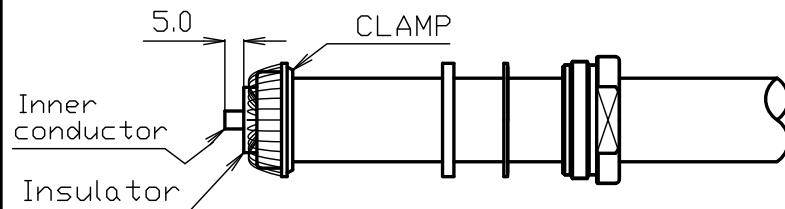

- Place clamp over outer conductor and push back against cable jacket. Fold back wires, trim to the same length. Cut off the insulator to the dimensions as shown in diagram.

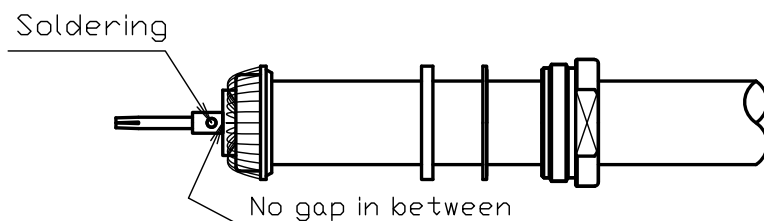

- Attach and solder the center pin to the inner conductor. Make sure there is no gap between the insulator and the center pin and that the solder is not raised. After solder, slightly pull the contact pin and make sure it is securely attached.

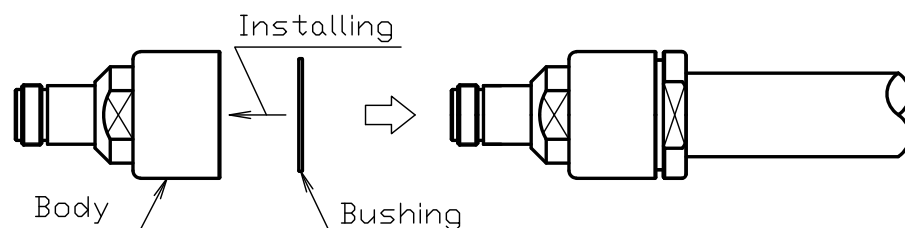

- Attach the bushing to the body, then attach the body to the cable. Tighten nut securely to complete.